



Majestic Manufacturing Inc.  
4536 State Route 7  
P.O. Box 128  
New Waterford, OH 44445  
USA  
Phone: 330-457-2447  
Fax: 330-457-7490  
www.majesticrides.com

Bulletin No.: S.A. 2012-01  
Release Date: 10-24-12  
Effective Date: 10-24-12  
Supercedes: All  
Completion Date: 10-24-12  
Page: 1 of 1

# SAFETY ALERT

Ride Manufacturer: Majestic Manufacturing

Affected Production Dates: All Production Dates

Ride Name: Musik Express

Affected Serial Nos.: All Serial Numbers

Model Number: All Model Numbers

**Abstract of Issue:**

Musik Express spreader ears have become damaged or worn beyond acceptable tolerances for operation.

**Reason For Release:**

The reason for this safety alert is to notify all inspectors, owners and, operators of a safety concern with the Musik Express spreader ears. We have found that over time the Musik Express spreader ears can become damaged or worn beyond acceptable tolerances for operation. This can be caused by the Musik Express spreader ear bushings are worn or the spreader ear bushings are not present.

**Action To Be Taken:**

All Musik Express amusement rides should be inspected for damaged or worn spreaders ears that are beyond acceptable tolerances for operation. Any Musik Express amusement rides that are found with damaged or worn spreaders ears that are beyond the acceptable tolerances must be replaced before operation.

The lowest acceptable tolerance for the material thickness for the Musik Express spreader ears is 85% of the original material thickness.

Original material thickness is 15 mm.

**Detail Of Issue:**

Figure 1:



This is a picture of a Musik Express spreader ear that is damaged and worn beyond acceptable tolerances.

