



ALLAN HERSCHELL

CHANCE
MANUFACTURING CO., INC.

Number: 125
Date: 6-29-76

Superceeds:
Number:
Date:

Service Information

Ride: YO YO

Subject: MAINTENANCE

During the recent inspection of YO YO's, several problems have been brought to our attention:

During set-up, pins securing sweep ends to tower must be removed before raising sweeps. Failure to do this has resulted in bent sweeps. If you cannot trust your help to remove the pins, leave them out when tearing ride down and wrap a chain around the sweeps securely.

On some rides the safety interlocks have been removed because of interference from bent sweeps. The interlocks are installed at the factory to help insure safe operation and should never be removed or altered.

The links and stripper bolts connecting the hub to the sweeps should only be replaced with factory purchased parts or parts meeting factory specifications.

The sweep pivot bearings should be greased weekly with the sweeps in full up, full down and several intermediate positions to grease the entire bearing. Teflon bearings which require no lubrication are available from the factory.

SEE REVERSE SIDE FOR DRAWING


Factory and General Office, 4219 Irving, Box 2397 Wichita, Kansas 67201

Area Code (316) 942-7411

Sales Office:

103 Ross Ave., Dallas, Texas 75202

Area Code (214) 742-3802

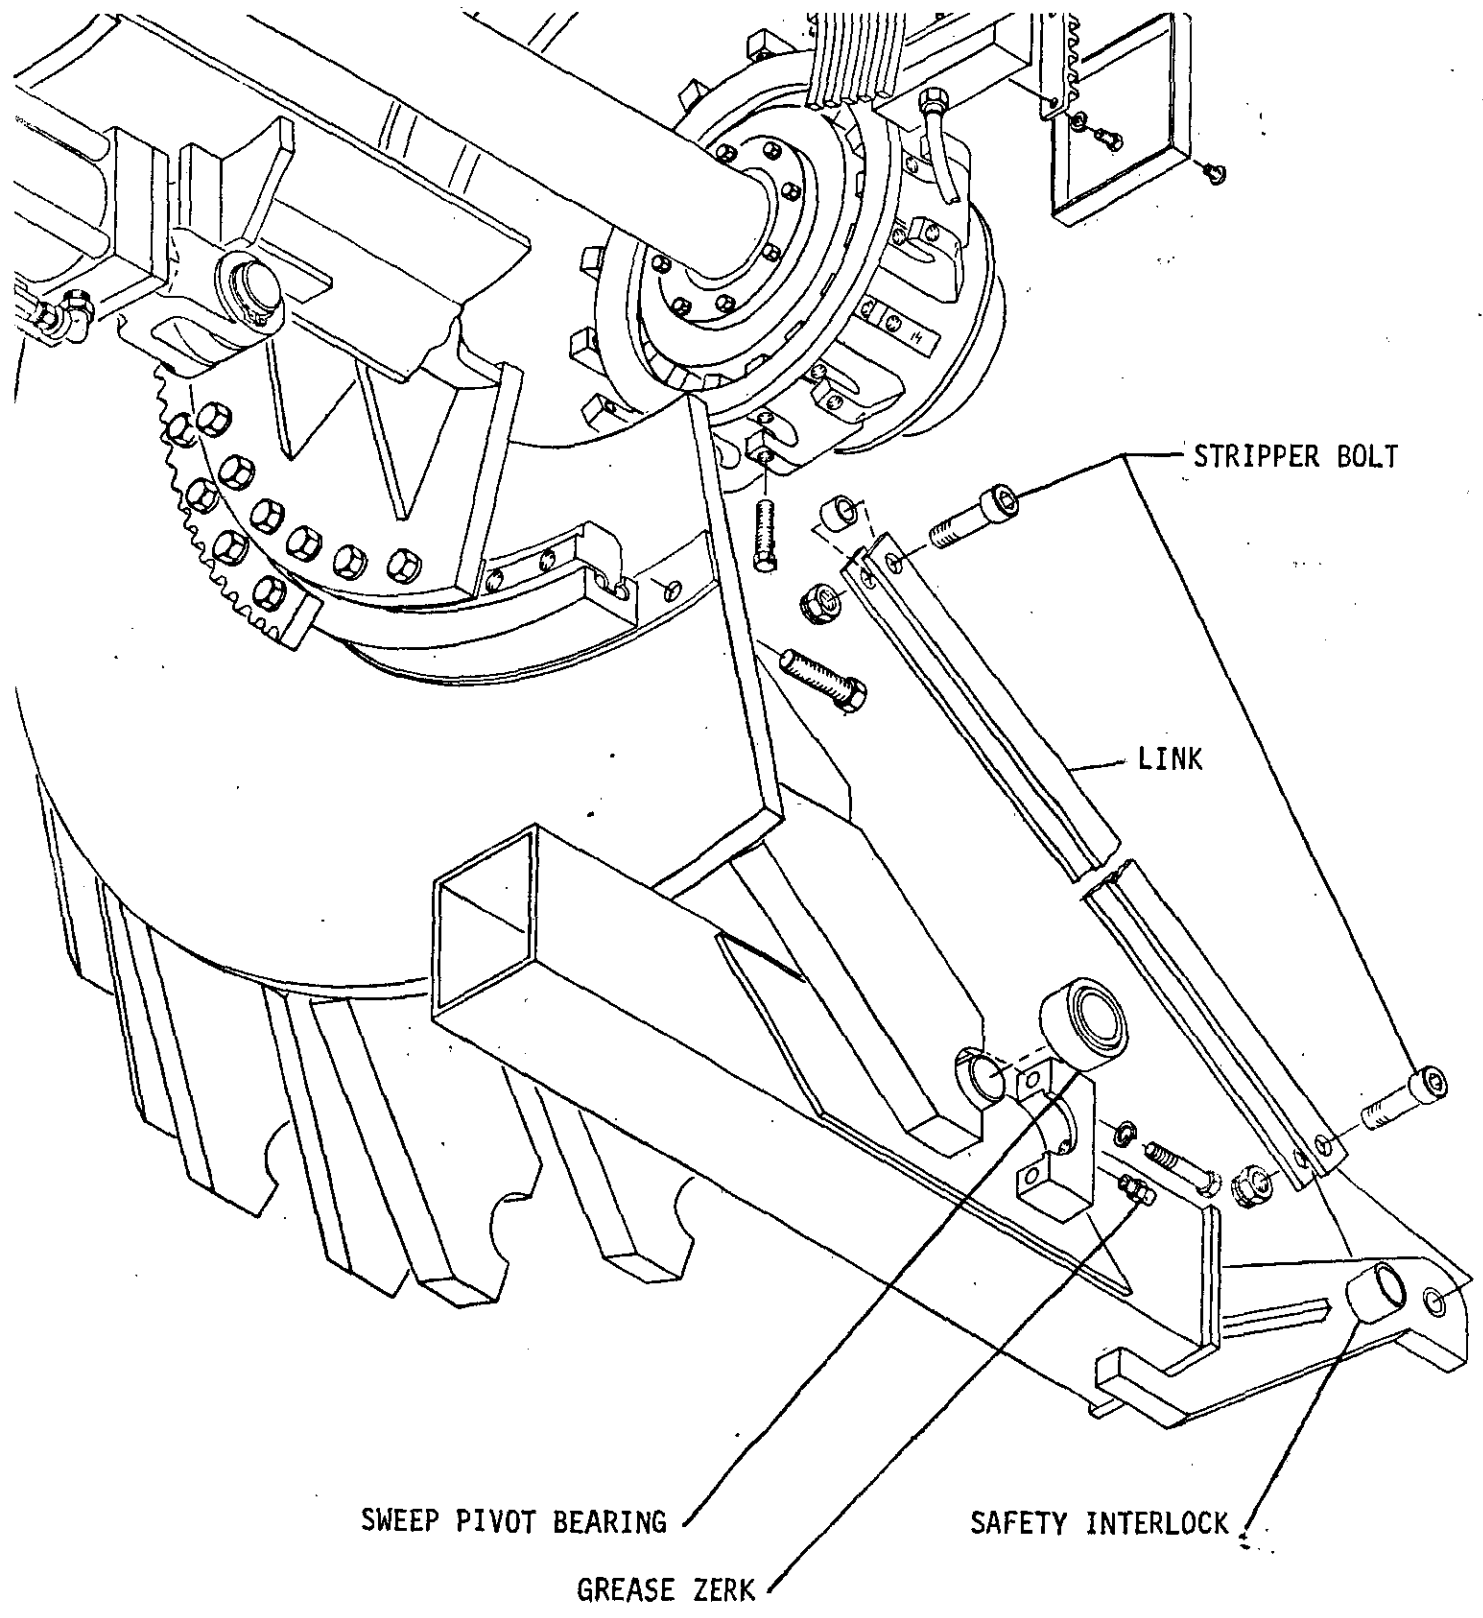

STRIPPER BOLT

LINK

SWEEP PIVOT BEARING

GREASE ZERK

SAFETY INTERLOCK